UI Bulletin #159

Subject:	Cap-less Fuel Cover
Models Years Affected:	2017 - 2019
Models Affected:	Chevrolet Silverado (old body style) GMC Sierra (old body style) With Cap-less Fuel Fill and Gasoline Engines
Origination Date:	September 4, 2019
Revision Date:	N/A

ADVISORY:

Condition/Concern:

Some customer/vehicle operators may express a concern that dirt, dust and other contaminates have a potential of entering the fuel filler/tank due to contaminants making their way past the seals on the cap less unit. This issue may occur on vehicles that predominately drive on unsealed or dirt roads. This issue occurs because the fill pocket is unsealed near the hinge, and the fill pocket door is also unsealed.

Repair/Recommendation:

Adding a tethered cap that covers the cap-less unit preventing contaminates from settling on the outer sealing door of the cap less unit. Refer to Additional Information for an illustration (Figure 1) and the part number of the tethered cap.

Additional Information:

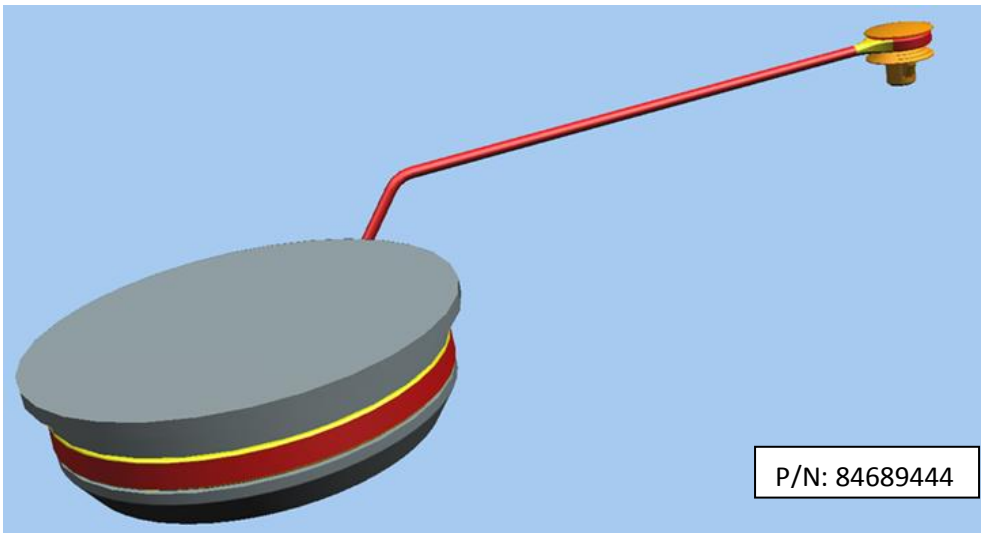

Figure 1

Disclaimer: GM Upfitter Integration Technical Bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service and/or modification of a vehicle. These properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. Contact GM Upfitter Integration for information on whether the information is applicable your vehicle.